
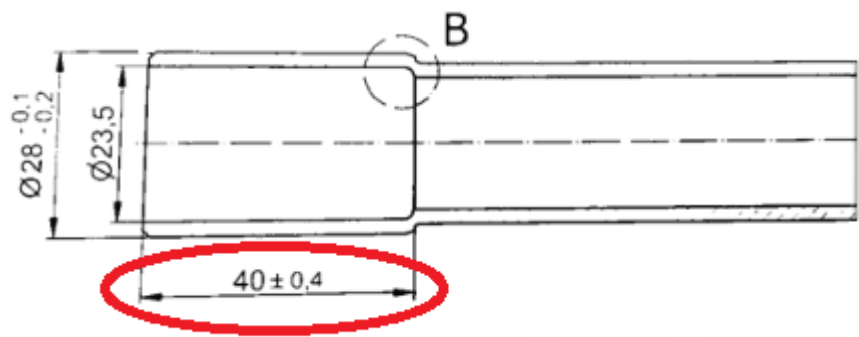


Technical Information (TI) from Fabric to Dealers.


MODEL and YEAR: EC 250 / 300 2018	SUBJECT: FRONT AXLE	DATE RELEASE: 03/05/2018	TI Nº: GGT - 06
---	-------------------------------	------------------------------------	---------------------------

Symptoms:	In very extreme cases, the axle of the front wheel in GASGAS EC 250/300 2018 models could fracture.
Repair procedure:	To know if the axle is correct, the method of verification is the following: The dealer must check the internal depth measurement on the front axle. If it is incorrect, it must be replaced by a correct axle. Some of major markets are receiving some axles for your initial demand. If you need more quantities, you should ask our Spare Parts Department (see below). The verification method is as follows: • <u>Correct</u> measure: 40 ± 0.4 m/m • <u>NOT correct</u> measure: 47 ± 0.4 m/m TECHNICAL ASPECTS: 

MEASURE OK → **AXLE OK**

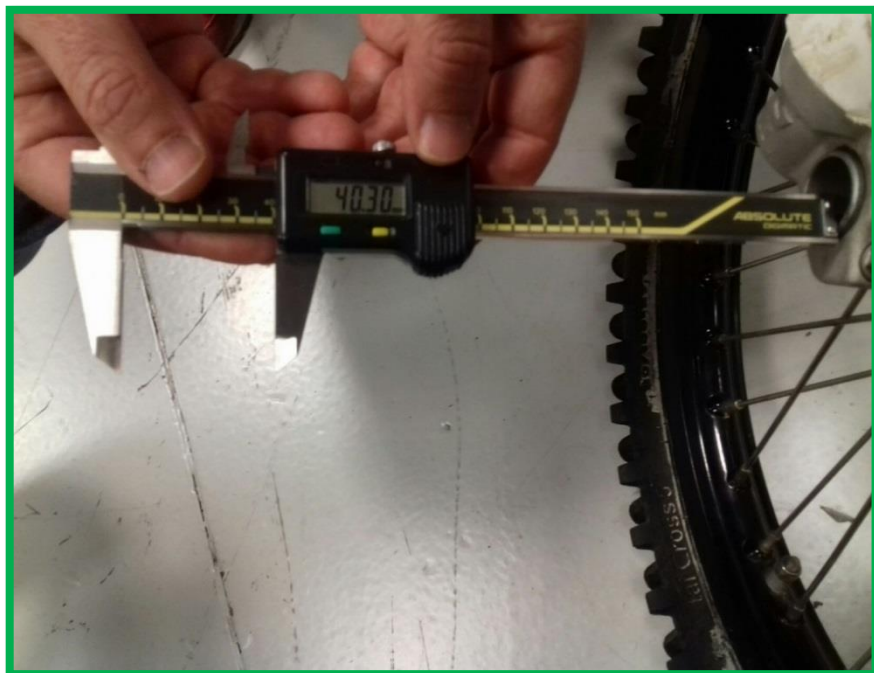

MEASURE **NO OK!**

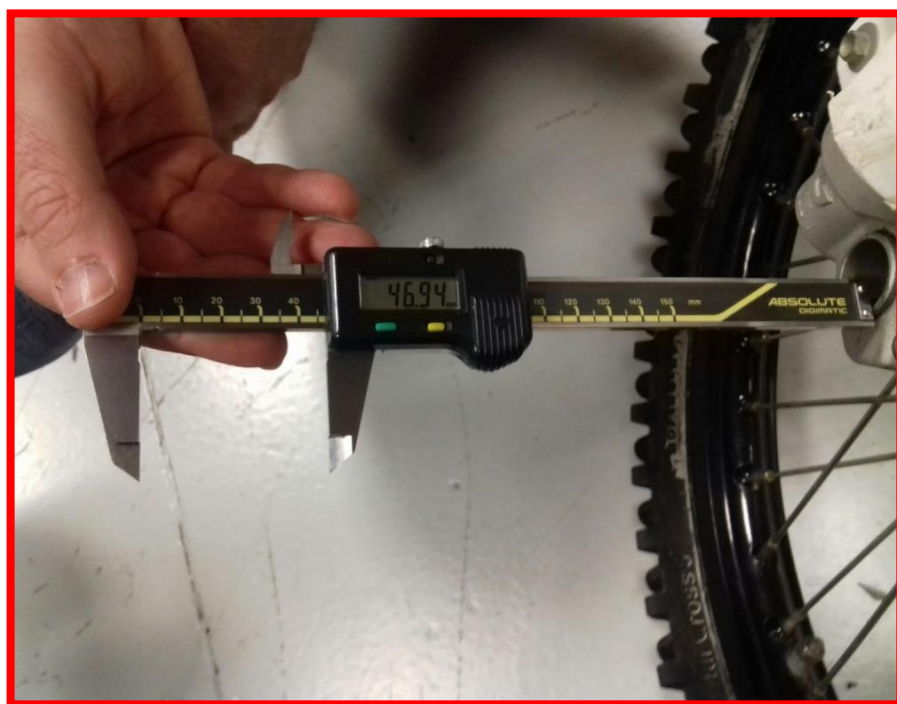

<u>Countermeasure:</u>	It has been ensured that the substitution axes comply with the original measurements
<u>Affected lots:</u>	VIN numbers involved from 1th May 2017: -VTR4E2500J0570003 -VTR4E3000J0570003 - VTRECH2C0IG400004 to: March 2018 -VTR4E2500J0280479 -VTR4E3000J0381746 -VTRECH2C9JG300148
<u>Order parts:</u>	To place orders to the Spare Parts Department, due to the fire of our factory, they can NOT be ordered through the SOFTWAY system. You must order the axles directly by E-MAIL to: Partsgg2@gasgas.com (JAVI) Export. Partsgg3@gasgas.com (SERGI) National + Latam.
<u>Countermeasure part:</u>	Reference for submit the warranty claim to DEIWEB. -BE53000R3011
<u>Labour time:</u>	10 minutes
<u>Labour price:</u>	35€ / Hour
<u>Warranty claim:</u>	Deiweb